



# Hiskins Electrical Services

01455 360 370 - 07455 640640  
Commercial & Domestic Electricians

# Quote

**From:**

Hiskins Electrical Services

Holly Lane, Barwell, Leicestershire, LE9 8BT

Enquiries@HiskinsElectrical.co.uk

Quote  
Number

QUO-2988

Quote Date

14th September  
2020

Valid Until

13th November  
2020

**Total**

**£670.98**

**To:**

Reesa Tainton

9 Beech Road, Leicester, LE3 3DB

reesa90@live.co.uk

Extract of email dated 14/9/2020

Item No.

5 - Installation of bonding to water services - £30 Materials, £60 Labour

8 - Supply and installation of new appropriately sized mcb for shower circuit - Cost of materials only £20

11 - If the correct size of fuse is being used in the FCU that is supplying this socket then the cable size is fine. If not then this could be easily rectified for a matter of pence. As for the Garage supply this would need to be addressed should you wish to keep the power out there, if not simply disconnecting it at this time would be the best solution. If this isn't an option I would suggest an onsite consultation to assess the requirements is required to quote accurately.

12 - Repeated Item. (Number 8)

13 - This would need some further investigation, it could be being caused by something as simple as a loose connection at the back of one of the sockets or it could be due to cable insulation degradation. Removing all sockets and checking connection would be my first action, generally for further investigation of this nature I suggest an initial amount of time is assigned of 2 hours to allow for all connections to be checked and re-terminated if required and allow time for the circuit to be re tested. This would be a cost of £90 for the initial 2 hours. Following this we can assess further if required and agree upon any further action required.

14 - This is often caused where a ring final socket circuit has been divided into 2 separate circuits at a point in time. First this would need to be confirmed by working around the sockets, testing at each one to establish where the break is, once this is confirmed we can assess the reason why it has been done and either if possible re-connect or allow the 2 circuits to remain and down grade the fuse protecting them to ensure the cables do not become overloaded and cause a fire. Again an initial 2 hours to locate the break if present and re test appropriately. £90 + cost of new MCB £20

16 - This suggests that the socket that is in use for powering the cooker and hob is not made to

Thanks for choosing [Hiskins Electrical Services](#) | Commercial & Domestic Electricians

Please Note Hiskins Electrical Services is not a VAT registered business and as such you will not be charged extra for VAT

For our full service terms and conditions please visit [www.hiskinselectrical.co.uk](http://www.hiskinselectrical.co.uk)



# Hiskins Electrical Services

01455 360 370 - 07455 640640  
Commercial & Domestic Electricians

# Quote

British standards, presuming the power usage of the cooker and hob are low enough to be powered by a 13amp socket and that indeed the socket they are using does not meet British standards, then a simple replacement socket is all that will be required. - Materials £6 Labour £10

20 - Based on the report it looks as though your installation as it is today was completed under the 16<sup>th</sup> edition of the electrical regulations, as at this time no RCD protection was required for low voltage circuits serving a room with a bath or a shower this should be coded a C3, that said my personal opinion based on my professional knowledge would lead me to advise you if possible to seriously consider addressing this by adding RCD protection for all circuits but especially any that serve a room with a bath or shower.

21 - Supply and installation of supplementary bonding Materials £35 Labour £45 - £135. Please note this may require items such as bath panels, bathroom cabinets or sink units, flooring and floors to be removed/ lifted and re-laid. A firm price will be given prior to work commencing once an onsite assessment of the amount of work that is required to achieve the goal.

22 - This would need some further investigation, it could be being caused by something as simple as a loose connection at the back of one of the sockets or it could be due to cable insulation degradation. Removing all sockets and checking connection would be my first action, generally for further investigation of this nature I suggest an initial amount of time is assigned of 2 hours to allow for all connections to be checked and re-terminated if required and allow time for the circuit to be re tested. This would be a cost of £90 for the initial 2 hours. Following this we can assess further if required and agree upon any further action required.

23 - Repeated item.(Number 16)

24 - Repeated Item (Number 20)

25 - Repeated Item. (Number 11)

27 - Repeated Item. (Number 22)

Items that have been assessed as C3 which I would deem C2 or FI and recommend are addressed as part of any remedial work.

Item Number

4 - Upgrade meter tails if isolation is possible. Materials £40 - Labour £45

10 - If you are to keep the supply to the garage then the cable should be properly supported.

Hrs/Qty	Service	Rate/Price	Sub Total
1	Materials & Labour Cost of Labour and Materials as per the details of the email regarding your EICR as can be found in the description section of this quote.	£559.15	£559.15
		Sub Total	£559.15
		VAT Not Applicable	£111.83

Thanks for choosing [Hiskins Electrical Services](#) | Commercial & Domestic Electricians  
Please Note Hiskins Electrical Services is not a VAT registered business and as such you will not be charged extra for VAT  
For our full service terms and conditions please visit [www.hiskinselectrical.co.uk](http://www.hiskinselectrical.co.uk)



## **Hiskins Electrical Services**

**01455 360 370 - 07455 640640**  
Commercial & Domestic Electricians

# Quote

**Total**

**£670.98**

All our work is covered by our 6 year guarantee which is backed by our government approved competent persons scheme Stroma. Our membership with Stroma allows us to certify all works carried out with local building regulations as required by law for PartP of the building regulations.

Some costs in this quote are variable e.g. labour for item no. 21. Also prices for items such as replacement MCB's are to be confirmed, your final invoice will reflect the actual labour costs inline with the amount of time required (No additional costs will be charged without prior permission) for items such as MCB's the initial price has been inflated to ensure costs are adequately covered and in this case it is anticipated that you will be charged less on receipt of your final invoice.

On acceptance of this quote a 25% deposit is required to cover materials and secure time in our schedule to carry out your work. Deposits can be paid via bank transfer to Sort Code 090129 Ac No. 31668172.